

Subject: TICKING NOISE FROM PURGE VALVE	Bulletin No: 01-012/07
	Last Issued: 05/07/2007

BULLETIN NOTE

This bulletin supersedes the previous bulletin issued on 03/16/07. The APPLICABLE MODEL(S)/VINS information has been revised.

APPLICABLE MODEL(S)/VINS

2005 - 2007 Mazda6 3.0L vehicles produced before Oct. 10, 2006


DESCRIPTION

On some vehicles, a ticking noise can be heard in the vehicle cabin during slow acceleration between 900 - 1200 RPM. Due to purge valve operation, (located on bulkhead) vibration may occur and transmit noise into the vehicle cabin through the bulkhead and dash panel. As a mass-production improvement, the length and diameter of the rubber mount was increased, and the rubber was hardened. The purge valve hoses were also lengthened.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace purge valve installation rubber mount and purge valve hoses with modified parts.

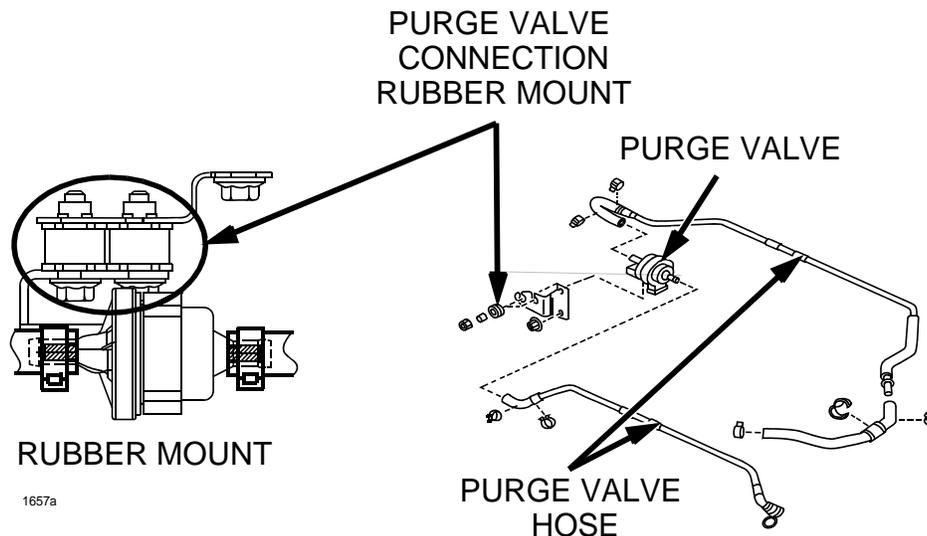

3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
AJB4-18-8DXC	Bracket Assembly	1
AJTT-20-360	Hose	1
AJTT-20-370	Hose	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	9W
Part Number Main Cause	AJB4-18-8DXC
Quantity	1
Operation Number / Labor Hours:	XXB476RX / 0.5 Hrs